



1. Remove, but do not discard, bolt washer (1) and (4) (Fig. 1).
2. Remove, but do not discard, nut washer (2) (Fig. 1).
3. Remove, but do not discard, nut washer (3) from shortest copper bolt on cap (Fig. 1).
4. Gently remove solenoid cap.
5. **Important!** Snip wire (5) **as close as possible** to large copper bolt. See Fig. 2.
6. Discard old copper bolt and cap.
7. Replace old plunger (6) with new plunger provided in kit.
8. Guide small bolt (7) through hole in new cap as shown in Fig. 3.
9. Solder cut wire (5) to new copper bolt terminal (8). **Caution!** Solder wire to terminal so as not to interfere with contact of plunger to terminal.
10. Install new cap.
11. Reassemble nuts, bolts and washers (1) (2) (3) (4) as shown in Fig. 1. replace worn parts with those provided in kit.